

**Virginia Electric And Power Company
Surry Power Station
5570 Hog Island Road
Surry, Virginia 23883**

December 16, 1998

U. S. Nuclear Regulatory Commission
Attention: Document Control Desk
Washington, D. C. 20555

Serial No.: 98-727
SPS: BCB
Docket No.: 50-280
License No.: DPR-32

Dear Sirs:

Pursuant to 10 CFR 50.73, Virginia Electric and Power Company hereby submits the following Licensee Event Report applicable to Surry Power Station Unit 1.

Report No. 50-280/1998-014-00

This report has been reviewed by the Station Nuclear Safety and Operating Committee and will be forwarded to the Management Safety Review Committee for its review.

Very truly yours,



E. S. Grecheck
Site Vice President

Enclosure

Commitments contained in this letter:

1. Approved Root Cause Evaluation recommendations, designed to prevent the recurrence of a similar event, will be implemented.

9812230234 981216
PDR ADOCK 05000280
S PDR

IE22

cc: U. S. Nuclear Regulatory Commission
Region II
Atlanta Federal Center
61 Forsyth Street, SW, Suite 23T85
Atlanta, Georgia 30303

Mr. R. A. Musser
NRC Senior Resident Inspector
Surry Power Station

LICENSEE EVENT REPORT (LER)

(See reverse for required number of
digits/characters for each block)

Estimated burden per response to comply with this mandatory information collection request: 50 hrs. Reported lessons learned are incorporated into the licensing process and fed back to industry. Forward comments regarding burden estimate to the Records Management Branch (T-6 F33), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, and to the Paperwork Reduction Project (3150-0104), Office of Management and Budget, Washington, DC 20503. If an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.

FACILITY NAME (1)

SURREY POWER STATION, Unit 1

DOCKET NUMBER (2)

05000 - 280

PAGE (3)

1 OF 4

TITLE (4)

Manual Reactor Trip in Response to Main Feedwater Regulating Valve Failure

| EVENT DATE (5) | | | LER NUMBER (6) | | | REPORT DATE (7) | | | OTHER FACILITIES INVOLVED (8) | |
|---|-----|------|--------------------|-------------------|-----------------|-------------------|-----|------|---|---------------|
| MONTH | DAY | YEAR | YEAR | SEQUENTIAL NUMBER | REVISION NUMBER | MONTH | DAY | YEAR | FACILITY NAME | DOCKET NUMBER |
| 11 | 26 | 1998 | 1998 | 014 | 00 | 12 | 16 | 1998 | | 05000 -- |
| THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more) (11) | | | | | | | | | | |
| OPERATING MODE (9) | | N | 20.2201(b) | | | 20.2203(a)(2)(v) | | | 50.73(a)(2)(i) | |
| POWER LEVEL (10) | | 81% | 20.2203(a)(1) | | | 20.2203(a)(3)(i) | | | 50.73(a)(2)(viii) | |
| | | | 20.2203(a)(2)(i) | | | 20.2203(a)(3)(ii) | | | 50.73(a)(2)(ii) | |
| | | | 20.2203(a)(2)(ii) | | | 20.2203(a)(4) | | | 50.73(a)(2)(iii) | |
| | | | 20.2203(a)(2)(iii) | | | 50.36(c)(1) | | | 50.73(a)(2)(iv) | |
| | | | 20.2203(a)(2)(iv) | | | 50.36(c)(2) | | | 50.73(a)(2)(v) | |
| | | | | | | | | | 50.73(a)(2)(vii) | |
| | | | | | | | | | OTHER | |
| | | | | | | | | | Specify in Abstract below or in NRC Form 366A | |

LICENSEE CONTACT FOR THIS LER (12)

NAME

E. S. Grecheck, Site Vice President

TELEPHONE NUMBER (Include Area Code)

(757) 365-2000

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

| CAUSE | SYSTEM | COMPONENT | MANUFACTURER | REPORTABLE TO EPIX | CAUSE | SYSTEM | COMPONENT | MANUFACTURER | REPORTABLE TO EPIX |
|-------|--------|-----------|--------------------------|--------------------|-------|--------|-----------|--------------|--------------------|
| B | SJ | V | Bailey Controls Division | Y | | | | | |
| | | | | | | | | | |

SUPPLEMENTAL REPORT EXPECTED (14)

YES

(If yes, complete EXPECTED SUBMISSION DATE).

X

NO

EXPECTED SUBMISSION DATE (15)

MONTH

DAY

YEAR

ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines) (16)

On November 26, 1998, at 21:08, the Unit 1 steam generator (SG) "B" main feedwater regulating valve, 1-FW-FCV-1488, failed closed. A control room annunciator alarmed indicating a difference between the SG "B" feedwater and steam flow parameters. In response, the control room operator placed 1-FW-FCV-1488 in the manual control mode and attempted to open the valve. 1-FW-FCV-1488 remained closed, however, and the "B" SG level continued to decrease. To avert an automatic reactor trip due to low SG level coincident with a steam/feedwater flow mismatch, the control room operator initiated a manual reactor trip. The Unit 1 reactor tripped from 81% power and was followed by an automatic turbine trip, as designed. Appropriate operator actions were taken in accordance with emergency operating procedures to ensure the performance of system automatic actions and to respond to abnormal conditions. The event was caused by the dislocation of a retaining clip in the positioner pilot valve, which caused 1-FW-FCV-1488 to fail closed. Approved Root Cause Evaluation recommendations, designed to prevent the recurrence of a similar event, will be implemented. The NRC was notified pursuant to 10 CFR 50.72 (b)(2)(ii) on November 26, 1998 at 23:35. This report is being submitted pursuant to 10 CFR 50.73 (a)(2)(iv).

9812230237 981216
PDR ADOCK 05000280
S PDR

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

| FACILITY NAME (1) | DOCKET (2) | LER NUMBER (6) | | | PAGE (3) |
|-------------------------------|--------------|----------------|----------------------|--------------------|----------|
| SURREY POWER STATION , Unit 1 | 05000 -- 280 | YEAR | SEQUENTIAL NUMBER | REVISION NUMBER | 2 OF 4 |
| | | 1998 | -- 014 | -- 00 | |

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

1.0 DESCRIPTION OF THE EVENT

On November 26, 1998, at 21:08, the Unit 1 steam generator (SG) [EIS-AB,SG] "B" main feedwater regulating valve [EIS-SJ,FCV], 1-FW-FCV-1488, failed closed. A control room annunciator [EIS-IB] alarmed indicating a difference between the SG "B" feedwater and steam flow parameters. In response, the control room operator placed 1-FW-FCV-1488 in the manual control mode and attempted to open the valve. 1-FW-FCV-1488 remained closed, however, and the "B" SG level continued to decrease. To avert an automatic reactor trip due to low SG level coincident with a steam/feedwater flow mismatch, the control room operator initiated a manual reactor trip [EIS-JC]. The Unit 1 reactor tripped from 81% power and was followed by an automatic turbine trip [EIS-TA,TRB], as designed.

The auxiliary feedwater pumps [EIS-EIS-BA-P] started on low-low SG water level and provided flow to the SGs. The Anticipated Transient Without Scram Mitigation System Actuation Circuitry (AMSAC) [EIS-JE] armed and initiated, as designed. The main steam dump valves [EIS-SB,TCV] automatically opened to admit steam to the main condenser.

The RCS reached a minimum temperature of approximately 538°F and subsequently stabilized at 547°F. The reactivity shutdown margin was calculated following the RCS cooldown to ensure that Technical Specification and administrative shutdown margin limits were satisfied.

The following discrepancy was noted during the post-trip response:

- Moisture separator reheater control valve, 1-MS-FCV-104D [EIS-FCV], failed to fully close.

The NRC was notified pursuant to 10 CFR 50.72 (b)(2)(ii) on November 26, 1998 at 23:35. This report is being submitted pursuant to 10 CFR 50.73 (a)(2)(iv) as an event that resulted in the actuation of engineered safety features and the reactor protection system.

2.0 SIGNIFICANT SAFETY CONSEQUENCES AND IMPLICATIONS

This event resulted in no safety consequences or implications. Appropriate operator actions were taken in accordance with emergency operating procedures to ensure the performance of system automatic actions and to respond to abnormal conditions. The unit was quickly brought to a stable, no-load condition. Therefore, the health and safety of the public were not affected at any time during this event.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

| FACILITY NAME (1) | DOCKET (2) | LER NUMBER (6) | | | PAGE (3) |
|-------------------------------------|--------------|-------------------|----------------------|--------------------|----------|
| SURRY POWER STATION , Unit 1 | 05000 -- 280 | YEAR | SEQUENTIAL NUMBER | REVISION NUMBER | 3 OF 4 |
| | | 1998 -- 014 -- 00 | | | |

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

3.0 CAUSE

A Category 1 Root Cause Evaluation (RCE) was initiated on November 27, 1998, to determine the cause of this event and to recommend corrective actions. The RCE has preliminarily concluded that a retaining clip in the positioner pilot valve became dislocated, which caused 1-FW-FCV-1488 to fail closed. The RCE is continuing to investigate the cause of the retaining clip dislocation.

4.0 IMMEDIATE CORRECTIVE ACTION(S)

Following the reactor trip, Control Room Operators acted promptly to place the unit in a safe, shutdown condition in accordance with emergency and other operating procedures.

The Shift Technical Advisor monitored the critical safety function status trees to ensure that plant parameters remained acceptable.

5.0 ADDITIONAL CORRECTIVE ACTIONS

1-MS-FCV-104D was examined and found to be held in a partially open position as a result of the stem binding. The stem was cleaned and the valve was tested satisfactorily.

The pilot valve assembly for 1-FW-FCV-1488 and the retaining clip in the positioner were replaced. 1-FW-FCV-1488 was subsequently tested satisfactorily.

The RCE team is evaluating unit conditions and systems response contributing to the RCS cooldown following the reactor trip.

6.0 ACTIONS TO PREVENT RECURRENCE

Approved RCE recommendations, designed to prevent the recurrence of a similar event, will be implemented.

7.0 SIMILAR EVENTS

LER 50-281/1990-003-00 Manual Reactor Trip Due to Failure of "A" Main Feedwater Regulating Valve

LER 50-281/1991-011-00 High Steam Generator Level Due to Main Feedwater Regulating Valve Oscillations Results in ESF Actuations and Reactor Trip

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

| FACILITY NAME (1) | DOCKET (2) | LER NUMBER (6) | | | PAGE (3) |
|-------------------------------|--------------|----------------|----------------------|--------------------|----------|
| | | YEAR | SEQUENTIAL NUMBER | REVISION NUMBER | |
| SURREY POWER STATION , Unit 1 | 05000 -- 280 | 1998 | -- 014 | -- 00 | 4 OF 4 |

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

8.0 **MANUFACTURER/MODEL NUMBER**

Bailey Controls Division
AV1 Series Positioner

9.0 **ADDITIONAL INFORMATION**

Unit 1 was returned to service on November 27, 1998.

Unit 2 was operating at 100% power and was not affected by this event.

CATEGORY 1

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR:9812230234 DOC.DATE: 98/12/16 NOTARIZED: NO DOCKET #
FACIL:50-280 Surry Power Station, Unit 1, Virginia Electric & Powe 05000280
AUTH.NAME AUTHOR AFFILIATION
GRECHECK,E.S. Virginia Power (Virginia Electric & Power Co.)
RECIP.NAME RECIPIENT AFFILIATION
Records Management Branch (Document Control Desk)

SUBJECT: Forwards LER 98-014-00 per 10CFR50.73.Listed commitment
contained in ltr.

DISTRIBUTION CODE: IE22T COPIES RECEIVED:LTR 1 ENCL 1 SIZE: 2+4
TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:

05000280

| | RECIPIENT ID CODE/NAME | COPIES LTTR ENCL | RECIPIENT ID CODE/NAME | COPIES LTTR ENCL |
|-----------|---------------------------|---------------------|---------------------------|---------------------|
| | PD2-1 PD | 1 1 | EDISON,G. | 1 1 |
| INTERNAL: | ACRS | 1 1 | AEOD/SPD/RAB | 2 2 |
| | AEOD/SPD/RRAB | 1 1 | FILE CENTER | 1 1 |
| | NRR/DE/ECGB | 1 1 | NRR/DE/EELB | 1 1 |
| | NRR/DE/EMEB | 1 1 | NRR/DRCH/HICB | 1 1 |
| | NRR/DRCH/HOHB | 1 1 | NRR/DRCH/HQMB | 1 1 |
| | NRR/DRPM/PECB | 1 1 | NRR/DSSA/SPLB | 1 1 |
| | RES/DET/EIB | 1 1 | RGN2 FILE 01 | 1 1 |
| EXTERNAL: | L ST LOBBY WARD | 1 1 | LITCO BRYCE,J H | 1 1 |
| | NOAC POORE,W. | 1 1 | NOAC QUEENER,DS | 1 1 |
| | NRC PDR | 1 1 | NUDOCS FULL TXT | 1 1 |
| NOTES: | | 1 1 | | |

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE. TO HAVE YOUR NAME OR ORGANIZATION REMOVED FROM DISTRIBUTION LISTS OR REDUCE THE NUMBER OF COPIES RECEIVED BY YOU OR YOUR ORGANIZATION, CONTACT THE DOCUMENT CONTROL DESK (DCD) ON EXTENSION 415-2083

FULL TEXT CONVERSION REQUIRED

TOTAL NUMBER OF COPIES REQUIRED: LTTR 24 ENCL 24